#### Release Date: December 13, 2019

#### VRMF Level Data Results:

VRMF level From:	89.0.214.0
VRMF Level To:	89.1.23.0
Report for:	DS8900F

#### **Code Bundle Contents**

DS8900F Code Bundle Level	SEA or LMC Version:	DSCLI Client	Heat Map Transfer Utility	Storage Manager	Copy Services Manager
89.1.23.0	7.9.1.36	7.9.1.36	7.9.1.36	5.9.1.1016	6.2.6

Overview of new features and functions supported by this release on DS8900F 533x models 993/994/996

#### At a glance:

• Code fixes

## This new microcode release supports DS8900F systems only.

#### Select Modifications Included in this Release Note:

This is a list of some modifications contained across one or more LIC (License Internal Code) or microcode release(s). The potential impact is variable. Specific environments may aggravate or degrade the potential impact. Problem(s) fixed and reported in this release note may not be in higher levels of code bundles.

#### **Definition of Problem Severity:**

1	High Impact	<ul><li>Acute: Irrecoverable error with potential loss of data.</li><li>Serious: Irrecoverable error with potential loss of access to data, or critical function.</li></ul>
2	Moderate	- A function not operational and/or performance might be degraded.
3	Service	- A recoverable error (no impact) and service improvements.
4	Improvements	- Improvement changes for better Usability and Serviceability.

#### HIPER: High Impact problem that is Pervasive: 3 or more occurrences

## Acute: An irrecoverable error with potential loss of data.

#### **NVDIMMs deconfigured after power loss**

- 1. **Problem Description:** After unexpected power loss event, NVDIMM image may be corrupted on both clusters.
- 2. Potential Impact of Problem: loss of data
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346171

#### **Backup Power Module failure not detected**

- 1. **Problem Description:** NVDIMM BPM error log entries were missed, with the result that the affected Cluster was not shutdown, and no serviceable event was created.
- 2. Potential Impact of Problem: loss of data
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346191

#### Corrupted parity after array resync

- 1. **Problem Description:** Parity resync on a flash array encountered a locking issue with a host write while updating parity for the same stripe.
- 2. Potential Impact of Problem: loss of data
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346606

#### Data miscompare exposure

- 1. **Problem Description:** A rare timing window, combined with a data pattern on a boundary, can lead to a host write completing to media when initialization is required, without processing and clearing the initialization required indicator.
- 2. Potential Impact of Problem: Data miscompare
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346697

#### Data miscompare on SafeGuarded Copy recovery volume

- 1. **Problem Description:** Track Bitmap and Recovery Bitmap were out of sync during a host write to the recovery volume. This caused inconsistent data on the recovery volume, making it unusable.
- 2. Potential Impact of Problem: Data miscompare
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

# Serious: An irrecoverable error with potential loss of access to data, or critical function.

#### HIPER <u>Unable to IPL from SafeGuarded Copy recovery volume</u>

- 1. **Problem Description:** When using a Task Control Block with two Cache Track Requests to access a track on the recovery volume, the second access may discarded.
- 2. Potential Impact of Problem: IPL failure
- 3. Problem Severity: HIPER
- 4. Pervasive Problem: Yes

ID# 346511

#### Host bay failed auto-power-on

- 1. **Problem Description:** After a short-duration Power Line Disturbance, a host bay did not power on again because of a dual fan fault condition.
- 2. Potential Impact of Problem: loss of access
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346525

#### 0x1BB5 MLE

- **1. Problem Description:** Encryption key repository reads encountered lock contention between the two Clusters. May cause dual IML failure.
- 2. Potential Impact of Problem: loss of access
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

ID# 346673

#### Multiple path failure on Linux hosts during error recovery

- 1. **Problem Description:** For Linux hosts, change the default Queue Error management parameter to binary '00', to allow other commands in the task set to be processed after a check condition.
- 2. Potential Impact of Problem: loss of access
- 3. Problem Severity: High Impact
- 4. Pervasive Problem: No

# Moderate: A system path is not operational and/or performance may be degraded.

#### 0x790B MLE running Dataset-level cascaded FlashCopy

- 1. **Problem Description:** While creating and withdrawing multiple relationships, a microcode logic error was encountered in Background Copy queue management.
- 2. Potential Impact of Problem: Warmstart
- 3. Problem Severity: Moderate
- 4. Pervasive Problem: No

ID# 341109

#### 0x7F31 MLE

- 1. **Problem Description:** Fast Reverse Restore was allowed to be initiated targeting a SafeGuarded Copy source volume, that was not also a Global Mirror FlashCopy source volume.
- 2. Potential Impact of Problem: Warmstart
- 3. Problem Severity: Moderate
- 4. Pervasive Problem: No

ID# 337401

#### Deconfigured NVDIMM after PHYP crash

- **1. Problem Description:** After a Hypervisor crash, NVDIMMs are left with a corrupt image, and are deconfigured.
- 2. Potential Impact of Problem: Cluster IML failure
- 3. Problem Severity: Moderate
- 4. Pervasive Problem: No

ID# 346139

#### Host Adapter 0x0B8A MLE

- 1. **Problem Description:** During HA fastload, failure to handle linked commands triggered a microcode logic error in the adapter.
- 2. Potential Impact of Problem: Warmstart
- 3. Problem Severity: Moderate
- 4. Pervasive Problem: No

ID# 346953

#### 0x7A2A MLE

- 1. **Problem Description:** Copy Services journal cleaner task failing with a microcode logic error, caused by syntax errors in code.
- 2. Potential Impact of Problem: Warmstart
- 3. Problem Severity: Moderate
- 4. Pervasive Problem: No

## Service: A recoverable error, Service improvements.

#### Unable to install Customer-signed certificates using Chrome

- 1. **Problem Description:** Unable to upload certificate files using newer versions of Chrome browser.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: Yes

ID# 344292

#### End-of-Call does not identify failed Storage Manager service

- 1. **Problem Description:** When running End-of-Call check, Service Representative is not notified when Storage Manager service has failed.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

ID# 345893

#### HMC console Shift+M shortcut fails

- **1. Problem Description:** After opening browser, DS Storage Manager link works, but Shift+M shortcut displays an error.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

ID# 346048

#### DS GUI audit log offload fails

- 1. Problem Description: Two ESSNI functions were combined into a single .jar file in R8.5 SP1.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

ID# 346266

#### DS GUI cache resync hang

- 1. **Problem Description:** Volume Rebalance was stalled because it encountered out of space condition on target ranks, then restarted rather than processing the next queue.
- 2. Potential Impact of Problem: DS GUI storage manager hang
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

#### Unable to login to WUI

- 1. **Problem Description:** WUI login fails if default "Customer" ID does not exist. (Customer ID is automatically removed when creating other users with "esshmccustomer" role.)
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: Yes

ID# 346643

#### Test Callhome utility failure

- 1. **Problem Description:** When running Test Callhome utility, two synchronous processes conflict, causing process hang and eventual test failure.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

ID# 346851

#### **Improve BPM lifetime calculations**

- 1. **Problem Description:** NVDIMM Backup Power Module lifetime calculations were pessmistic under some environmental conditions.
- 2. Potential Impact of Problem: none
- 3. Problem Severity: Service
- 4. Pervasive Problem: No

ID# 346478

## **Improvements: Improvements for better usability**

None.

#### Trademarks

The following terms are trademarks of the International Business Machines Corporation in the United States, other countries, or both.

- > AIX
- > Enterprise Storage Server
- > ESCON
- > FICON
- > i5/OS
- > iSeries
- > IBM
- > pSeries
- > S/390
- > System Storage
- > TotalStorage
- > z/OS
- > zSeries

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at Copyright and trademark information at http://www.ibm.com/legal/us/en/copytrade.shtml. Adobe, the Adobe logo, PostScript, and the PostScript logo are either registered

trademarks or trademarks of Adobe Systems Incorporated in the United States, and/or other countries.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Oracle and/or its affiliates.

Linux is a trademark of Linus Torvalds in the United States, other countries, or both.

Microsoft, Windows, and Windows NT are trademarks of Microsoft Corporation in the United States, other countries, or both.

© Copyright IBM Corp. 2004, 2011

## Notices

This information was developed for products and services offered in the U.S.A. IBM may not offer the products, services, or features discussed in this document in other countries. Consult your local IBM representative for information on the products and services currently available in your area. Any reference to an IBM product, program, or service is not intended to state or imply that only that IBM product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any IBM intellectual property right may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any non-IBM product, program, or service.

IBM may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not give you any license to these patents. You can send license inquiries, in writing, to: IBM Director of Licensing

**IBM** Corporation North Castle Drive Armonk, NY 10504-1785 U.S.A.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: INTERNATIONAL BUSINESS MACHINES CORPORATION PROVIDES THIS PUBLICATIONS "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. IBM may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.