Release Date: 30 April, 2025

VRMF Level Data Results:

VRMF level From:	89.42.18.0
VRMF Level To:	89.43.3.0
Report for:	DS8900F

Code Bundle Contents

DS8900F Code	SEA or LMC	DSCLI Client	Heat Map	Storage	Copy Services
Bundle Level	Version:		Transfer Utility	Manager	Manager
89.43.3.0	7.9.43.10	7.9.43.10	7.9.43.10	5.9.43.1006	6.3.10

Overview of new features and functions supported by this release on DS8900F 533x and 5341 models 993/994/996/998

At a glance:

• Code fixes

This new microcode release supports DS8900F systems only.

Select Modifications Included in this Release Note:

This is a list of some modifications contained across one or more LIC (License Internal Code) or microcode release(s). The potential impact is variable. Specific environments may aggravate or degrade the potential impact. Problem(s) fixed and reported in this release note may not be in higher levels of code bundles.

Definition of Problem Severity:

1	High Impact	Acute: Irrecoverable error with potential loss of data.Serious: Irrecoverable error with potential loss of access to data, or critical function.		
2	Moderate	- A function not operational and/or performance might be degraded.		
3	Service	- A recoverable error (no impact) and service improvements.		
4	Improvements	- Improvement changes for better Usability and Serviceability.		
TTTT				

HIPER: High Impact problem that is Pervasive: 3 or more occurrences

Acute: An irrecoverable error with potential loss of data.

None.

Serious: An irrecoverable error with potential loss of access to data, or critical function.

Transparent Cloud Tiering copier improvements

- **1 Problem Description:** Code enhancements to improve TCT copier performance, and reliability.
- 1 Potential Impact of Problem: Degraded throughput, job hangs.
- 2 Environment: All R9 using TCT
- 3 Problem Severity: High Impact
- 4 Pervasive Problem: No.

ID# 367069

Safeguarded Copy source volumes write inhibited

- **1 Problem Description:** When an extent pool is out of space, Safeguarded Copy is taking too long to fail the operation, and free the lock needed to allow roll-off to free up space in the pool.
- 2 Potential Impact of Problem: Loss of access
- **3 Environment:** All R9 using Safeguarded Copy
- 4 **Problem Severity:** High Impact
- 5 Pervasive Problem: No

ID# 368070

I/O timeouts caused by missing State Change Interrupt (SCI)

- **1 Problem Description:** If the paths to a device from a specific host image are in a Mixed grouped/ungrouped state, and a SCI is first offloaded on one of the ungrouped paths, the SCI indication for the grouped paths will also be cleared.
- **2 Potential Impact of Problem:** I/O timeouts when undergoing CS state transitions, or are coming out of long busy.
- **3** Environment: R9.4.x and z/OS workloads
- 4 **Problem Severity:** High Impact
- 5 Pervasive Problem: No

Moderate: A system path is not operational and/or performance may be degraded.

Host Adapter MLE

- **1 Problem Description:** While processing an inbound exchange, a SAN link event may trigger a Microcode Logic Error.
- 2 Potential Impact of Problem: Warmstart
- **3 Environment:** All R9
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: Yes

ID# 356274

0x5039 MLE

- **1 Problem Description:** When quiescing a CKD volume for CS activity, code will wait for I/Os on volume 0000 to complete, regardless of which volume is being quiesced.
- 2 Potential Impact of Problem: Warmstart.
- **3 Environment:** All R9 using CKD volumes.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 366400

Transparent Cloud Tiering unresponsive after a shutdown attempt

- **1 Problem Description:** A core segmentation fault can be triggered by the TCT shutdown process if it is performed while there is I/O running.
- 2 Potential Impact of Problem: TCT unusable until restarted.
- **3 Environment:** All R9 using TCT.
- 4 **Problem Severity:** Moderate
- 5 Pervasive Problem: No

ID# 368945

IOS6411 PORT STATE CHANGE messages for zHyperlinks

- **1 Problem Description:** z/OS is issuing a link reset to zHyperlinks, for timeouts that are not understood by DS8k or z development. Accordingly we are adding a long-term trace buffer, to better capture what is occurring.
- 2 Potential Impact of Problem: zHyperlink down for ~20 seconds
- **3 Environment:** All R9 using zHyperlinks
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

IEA494I PPRC PAIR DUPLEX PENDING FC messages missed by GDPS

- **1 Problem Description:** If a FlashCopy establish (or withdraw) causes a PPRC pair to go pending, present the SCI to all volumes, not just online volumes.
- 2 Potential Impact of Problem: Failure to warn that the environment is not Hyperswap capable.
- **3 Environment:** All R9 using zHyperswap.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 369233

0x21E1 MLE

- **1 Problem Description:** Two Safeguarded Copy tasks "collided" while deallocating cache segments on the same cache track.
- 2 Potential Impact of Problem: Warmstart.
- **3** Environment: All R9 using Safeguarded Copy recovery point on an active backup.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 369645

0x4143 MLE, End of Chain Task Timeout

- **1 Problem Description:** A deadlock can occur, if a FlashCopy establish is issued to a target volume, that is also a PPRC primary, and suspend command is issued to this volume.
- 2 Potential Impact of Problem: Warmstart.
- 3 Environment: All R9 using FlashCopy onto PPRC
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 370151

0x062E MLE

- **1 Problem Description:** zHyperlink write task was interrupted by a subsequent zHyperlink write task.
- 2 Potential Impact of Problem: Warmstart.
- **3 Environment:** All R9 using zHyperlink.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 370313

DS CLI password still exposed

- **1 Problem Description:** When logging into a DS8000 using DS CLI, a specific sequence may reveal the login password. Prior fix does not always work.
- 2 Potential Impact of Problem: Security Exposure.
- **3 Environment:** All R9 using DS CLI on Windows.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

Enclosure Services Manager (ESM) fenced after Storage Enclosure midplane replaced

- **1 Problem Description:** Midplane repair does not reset state of ESMs immediately after it has passed verification.
- 2 Potential Impact of Problem: Extended service action.
- **3 Environment:** All R9
- 4 **Problem Severity:** Moderate
- 5 Pervasive Problem: No

ID# 371656

mkcloudserver fails with SSL handshake invalid certificate path exception

- **1 Problem Description:** Code logic sometimes selects the wrong certificates when creating the cloud
- 2 Potential Impact of Problem: Warmstart.
- 3 Environment: All R9 using multiple certificate pairs for TCT.
- 4 Problem Severity: Moderate
- 5 Pervasive Problem: No

ID# 372274

Service: A recoverable error, Service improvements

GUI dashboard showing different used vs provisioned total capacity

- **1 Problem Description:** GUI is receiving CKD volume information in number of cylinders, but lacks the code to process the conversion.
- 2 Potential Impact of Problem: Warmstart.
- **3 Environment:** All R9 using CKD volumes.
- 4 **Problem Severity:** Service
- 5 Pervasive Problem: No

ID# 370318

After CDA, collectedCodeLevels file contains incorrect code version

- **1 Problem Description:** Ensure process to collect local HMC levels, will also run for peer HMC.
- 2 Potential Impact of Problem: Incorrect reporting.
- 3 Environment: All R9
- 4 **Problem Severity:** Service
- 5 Pervasive Problem: No

ID# 371385

Cleanup AOS Entries in /etc/hosts on HMCs

- **1 Problem Description:** Entries provided to ensure Assist On-Site (AOS) availability are no longer needed, and are potentially counterproductive.
- 2 Potential Impact of Problem: Loss of remote support capability using AOS.
- 3 Environment: All R9
- 4 **Problem Severity:** Service
- 5 Pervasive Problem: No

Improvements: Improvements for better usability

Slow Transparent Cloud Tiering migration to Cloud

- **1 Problem Description:** Create additional logging for First-Time Data Capture.
- 2 Potential Impact of Problem: Degraded Performance
- **3 Environment:** All R9 using TCT
- 4 **Problem Severity:** Improvement
- 5 Pervasive Problem: No

ID# 364420

Certificate Signing Request abbreviates the STate attribute

- **1 Problem Description:** In CSR, ST=Arizona becomes ST=AZ, for example.
- 2 Potential Impact of Problem: Noncompliant CSR.
- 3 Environment: All R9, creating CSR using DS GUI. WUI is unaffected.
- 4 Problem Severity: Improvement.
- 5 Pervasive Problem: No.

ID# 365499

Resiliency improvement for SRC BE82CD7x

- **1 Problem Description:** 1 of 2 midplane VPD modules could not be read.
- 2 Potential Impact of Problem: Single point of repair
- 3 Environment: All R9
- 4 Problem Severity: Improvement
- 5 Pervasive Problem: Yes

ID# 371036

Pick up new HMC base

- **1 Problem Description:** Pick up new HMC base for security improvements.
- 2 Potential Impact of Problem: N/A
- 3 Environment: All R9
- 4 Problem Severity: Improvement.
- 5 **Pervasive Problem:** No.

Trademarks

The following terms are trademarks of the International Business Machines Corporation in the United States, other countries, or both.

- > AIX
- > Enterprise Storage Server
- > ESCON
- > FICON
- > i5/OS
- > iSeries
- >IBM
- > pSeries
- > S/390
- > System Storage
- > TotalStorage
- > z/OS
- > zSeries

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at Copyright and

trademark information at http://www.ibm.com/legal/us/en/copytrade.shtml. Adobe, the Adobe logo, PostScript, and the PostScript logo are either registered trademarks or trademarks of Adobe Systems Incorporated in the United States, and/or other countries.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Oracle and/or its affiliates.

Linux is a trademark of Linus Torvalds in the United States, other countries, or both.

Microsoft, Windows, and Windows NT are trademarks of Microsoft Corporation in the United States, other countries, or both.

© Copyright IBM Corp. 2004, 2011

Notices

This information was developed for products and services offered in the U.S.A. IBM may not offer the products, services, or features discussed in this document in other countries. Consult your local IBM representative for information on the products and services currently available in your area. Any reference to an IBM product, program, or service is not intended to state or imply that only that IBM product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any IBM intellectual property right may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any non-IBM product, program, or service.

IBM may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not give you any license to these patents. You can send license inquiries, in writing, to: IBM Director of Licensing IBM Corporation

North Castle Drive Armonk, NY 10504-1785 U.S.A.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: INTERNATIONAL BUSINESS MACHINES CORPORATION PROVIDES THIS PUBLICATIONS "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. IBM may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.